

SIL Number:	606-00083-002		
То:	Owners/Operators of Avidyne IFD 700-00083-() and Cirrus Fuel Quantity Gauges used on the Release 9 Cirrus Aircraft with DAU.		
Subject:	Incorrect Left and Right Low Fuel Warning discrete indications with a Release 9 Cirrus Aircraft		
Purpose:	This Service Information Letter (SIL) advises owners and operators of Avidyne Release 9 of a possible incorrect wiring installation of the fuel quantity gauges to the IFD, which could results in incorrect left and right low-fuel warning indications.		
Revision:	00	Date:	10/28/2009

Problem Description

This Service Information Letter (SIL) identifies the possible miss-wiring between the Avidyne IFD 700-00083-() to the Cirrus Fuel Quantity Gauges based on the documented errors found in 900-00016-000 Rev 03 Wiring Drawing.

If affected, the Cirrus Aircraft left and right low-fuel warning indications would be reversed.

Solution

Return to your initial Avidyne Release 9 Installation Distributor to accomplish Avidyne Service Bulletin 601-00083-007 to determine if the wiring of Release 9 Cirrus Aircraft IFD 700-00083-() to Cirrus fuel quantity gauges follows STC SA00282BO Installation Deviation 600-00250-003 Rev A. An Avidyne Release 9 Installation Distributor would need to accomplish the Avidyne Service Bulletin 601-00083-007 in full.

Effectivity

	Before Upgrade	After Upgrade
Description	Cirrus SR2X R9 Ship Kit	No change
Avidyne Part Number	800-00037-000	No change

Avidyne Entegra Release 9 system-equipped Cirrus aircrafts with Avidyne engine sensor units DAU.



Accomplishment Instructions:

Complete Avidyne Service Bulletin 601-00083-007 IFD 700-00083-() to Fuel Quantity Gauges Installation Verification and Correction for Low Fuel Warning Indications.

Warranty Information:

This service is covered under warranty.

Contact Information:

Any customer with an Entegra Release 9 IFD system installed on their Cirrus aircraft, please contact their Avidyne Release 9 Installation Dealer.